

**SUBJECT: CHANGE OF AIRCRAFT REGISTRATION (SUPERSEDES SL-177)**

Date: Jan 27/22

To all Customers, Operators and Service Centers:

Applicability: All PC-12 Series Aircraft

This Service Letter is issued to highlight the aircraft system and component setting adjustments needed if an aircraft registration is changed.

**For PC-12, PC-12/45 and PC-12/47 aircraft:**

- Complete the Owner / Operator Information Form to notify Pilatus of any changes. The form is located on the Pilatus website, go to [www.pilatus-aircraft.com](http://www.pilatus-aircraft.com) > Customer Support > Global Warranty
- GPS KLN90 (if installed)
  - Contact Bendix King Wingman for NAV Data Base Services and enroll. For registration and further information, go to <http://wingmanservices.bendixking.com> > wingman service support
- EGPWS (if installed)
  - Contact Honeywell for NAV Data Base Services and enroll. For registration and further information, go to <http://aerospace.honeywell.com/en> > Product & Services > database and Software Updates > Terrain Databases EGPWS - RAAS
- ATC Transponder
  - KT70, KT71
    - Adjust the aircraft registration number that is stored in the ATC transponder, refer to Honeywell Maintenance Manual document Number 006-05615-0002
  - GTX330D
    - Adjust the aircraft registration number that is stored in the ATC Transponder, refer to AMM 12-A-34-54-00-00A-903B-A
- ELT Emergency Locator Transmitter
  - A06 (if installed)
    - Send the ELT to an approved ELT service center for reprogramming
  - Kannad 406AF Emergency Locator Transmitter (if installed)
    - Adjust the stored aircraft registration number in the programming dongle, refer to Kannad Service Letter SL S18XX50X-25-02 or send to an approved ELT Service Center for reprogramming
- Adjust the stored aircraft registration number in the Engine Instrument System, refer to AMM 12-A-77-40-00-00A-903C-A (MSN 321, 401-888)
- Register the aircraft registration number with the designated Airworthiness Authority (and the emergency response center for the relevant country)
- Replace the call sign in the cockpit and the tail section. Replace the call sign under the wing (if installed)

- Replace the aircraft registration plate (immatriculation placard) (if installed)
- If required by the designated Airworthiness Authority, change the internal and external placards
- **Other Providers that need to be informed if applicable:**
  - Engine Trend Monitoring (ETM)
  - Honeywell Avionics Protection Plan (HAPP) and Mechanical Protection Plan (MPP), go to <http://aerospace.honeywell.com/en> > Produce & Services > Maintenance and Monitoring > Aftermarket Services
  - Aircraft Management Program

**NOTE:** Local modification and STCs are not mentioned in this Service Letter. Service Centers must investigate what is required.

Operators who require further information should contact their Service Center.

**For PC-12/47E aircraft:**

- Complete the Owner / Operator Information Form to notify Pilatus of any changes. The form is located on the Pilatus website, go to [www.pilatus-aircraft.com](http://www.pilatus-aircraft.com) > Customer Support > Global Warranty
- For aircraft with the PM-CPDLC Factory Option installed:
  - Register the aircraft with EUROCONTROL through the OneSky Online portal, go to: <https://ext.eurocontrol.int/auth4u/login/login>
- NAV database Services
  - Contact INDS Customer Support. For registration and further information, go to <http://inds.epicinds.com> > Support > Customer Support
- EGPWS (if installed)
  - Contact Honeywell for NAV Data Base Services and enroll. For registration and further information, go to <http://aerospace.honeywell.com/en> > Product & Services > database and Software Updates > Terrain Databases EGPWS - RAAS
- APEX APM settings file
  - Update the APEX APM settings file, refer to AMM 12-B-45-45-00-00A-553A-A. Change the settings as required
- Emergency Locator Transmitter
  - Kannad 406AF
    - Adjust the stored aircraft registration number in the programming dongle, refer to Kannad Service Letter SL S18XX50X-25-02 or send to an approved ELT Service Center for reprogramming
- Connected Flight Deck (cFD) (if installed)
  - Update the aircraft registration details stored in the cFD device

**NOTE:** To register the new PC-12 NG owner, Service Centers will need to obtain an Aspen Connected Service Center Installer Account, refer to AMM 12-B-46-20-12-00A-903A-A.

- Register the aircraft registration number with the designated Airworthiness Authority (and the emergency response center for the relevant country)
- Replace the call sign in the cockpit and the tail section. Replace the call sign under the wing (if installed)

- Replace the aircraft registration plate (immatriculation placard) (if installed)
- If required by the designated Airworthiness Authority, change the internal and external placards
- **Other Providers that need to be informed if applicable:**
  - Engine Trend Monitoring (ETM)
  - Honeywell Avionics Protection Plan (HAPP) and Mechanical Protection Plan (MPP), go to <http://aerospace.honeywell.com/en> > Produce & Services > Maintenance and Monitoring > Aftermarket Services
  - Aircraft Management Program
  - For Electronic Check List (ECL), go to <http://obds.com> > Contact

**NOTE:** Local modification and STCs are not mentioned in this Service Letter. Service Centers must investigate what is required.

Operators who require further information should contact their Service Center.

INTENTIONALLY BLANK